

- Explanation:**
- Asbestos-containing Exterior, Solid and/or Translucent
 - Asbestos-containing Carpet/Marble
 - Asbestos-containing Vinyl Floor Tile/Marble
 - Asbestos-containing Baseboard/Adhesive
 - Assumed asbestos-containing ceramic tile grout and/or adhesive on wall and/or floor

Department of Veterans Affairs
 Northern Arizona Veterans Affairs Health Care System (NAVAHCS)
 Outpatient Clinic - Building 117
 Prescott, Arizona


Asbestos-containing Material Locations - Main Level, North

ENVIRONMENTAL
 HEALTH & SAFETY
 4827 North Van Ness Blvd
 Suite 200
 Reno, NV 89503
 (775) 784-0000
 phs@ehs.dva.mil

PROJECT No: 11P-A3138
 SHEET: 4 ML
 DRAWN BY: S. RAYMAN
 DATE: 2/1/12
 REVISION BY: M. B. B. B.
 DATE: 4-2-12
 REVIEWED BY:
 DATE:

Department of Veterans Affairs
 Northern Arizona Veterans Affairs Health Care System (NAVAHCS)
 Outpatient Clinic - Building 117
 Prescott, Arizona
Asbestos Sample Locations - Main Level, North

PROJECT No: 11P-A3138
 SHEET: 1 SL
 DRAWN BY: S. Rayman
 DATE: 2-01-12
 REVISED BY: Monday
 DATE: 4-2-12
 REVIEWED BY:
 DATE:

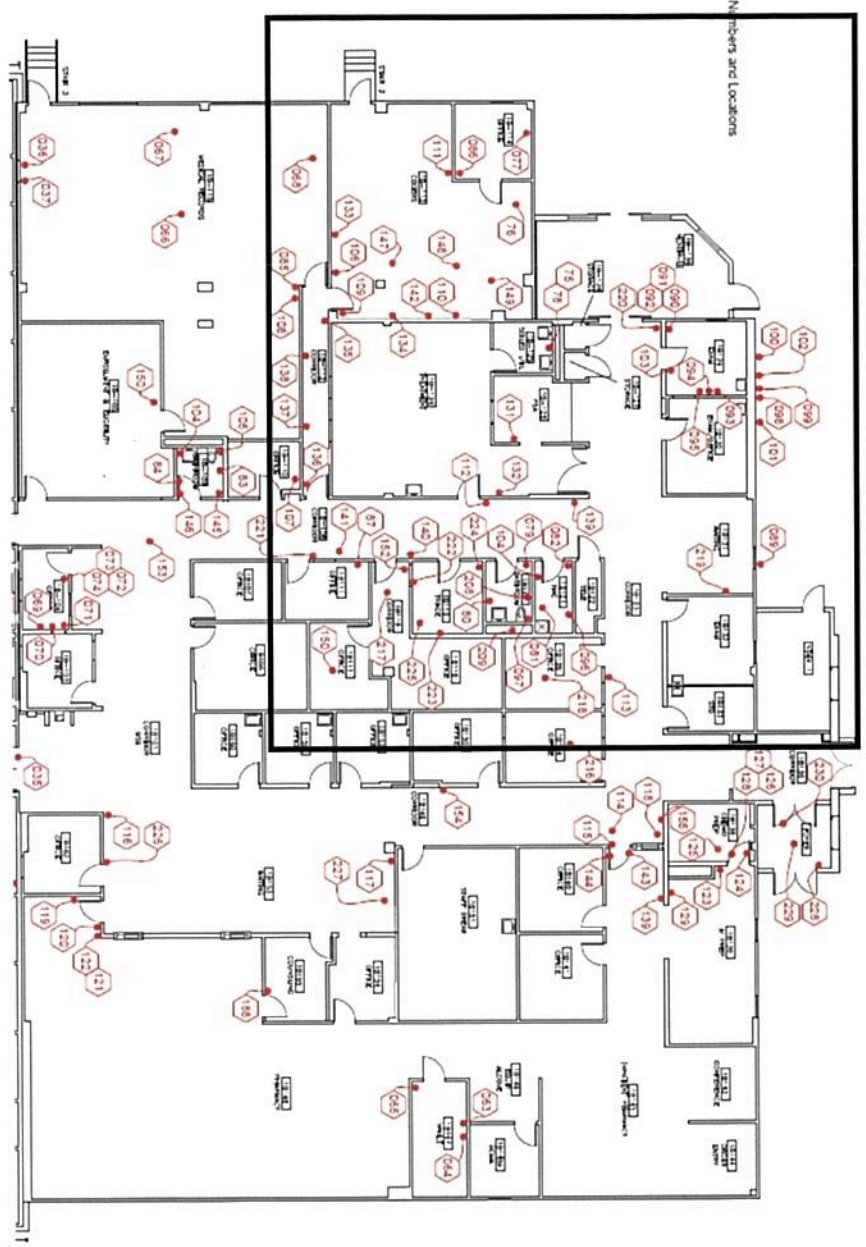

Explanation:
 Asbestos Sample Numbers and Locations

Client: IHI Environmental, Phoenix
C/O: Mr. Rod Pawloski
Re: 11P-A3138; NAVAHCS-Bldg 117

Date of Receipt: 01-17-2012
Date of Report: 01-20-2012

ASBESTOS PLM REPORT: EPA-600/M4-82-020 & EPA METHOD 600/R-93-116

Location: 117-086, Suspect ACM Materials

Lab ID-Version‡: 3892291-1

Sample Layers	Asbestos Content
Black Mastic	3% Chrysotile
Sample Composite Homogeneity:	Good

Location: 117-087, Suspect ACM Materials

Lab ID-Version‡: 3892292-1

Sample Layers	Asbestos Content
Pink Non-Fibrous Material	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Good

Location: 117-088, Suspect ACM Materials

Lab ID-Version‡: 3892293-1

Sample Layers	Asbestos Content
Gray Non-Fibrous Material	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Good

Location: 117-089, Suspect ACM Materials

Lab ID-Version‡: 3892294-1

Sample Layers	Asbestos Content
Gray Transite with Paint	20% Chrysotile
Brown Fibrous Material	ND
Composite Non-Asbestos Fibrous Content:	20% Cellulose
Sample Composite Homogeneity:	Good

Location: 117-090, Suspect ACM Materials

Lab ID-Version‡: 3892295-1

Sample Layers	Asbestos Content
White Drywall	ND
Composite Non-Asbestos Fibrous Content:	2% Cellulose
Sample Composite Homogeneity:	Good

The results relate only to the items tested. Interpretation is left to the company and/or persons who conducted the field work. The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government.

All samples were received in acceptable condition unless otherwise noted. EMLab P&K reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: IHI Environmental, Phoenix
C/O: Mr. Rod Pawloski
Re: 11P-A3138; NAVAHCS-Bldg 117

Date of Receipt: 01-17-2012
Date of Report: 01-20-2012

ASBESTOS PLM REPORT: EPA-600/M4-82-020 & EPA METHOD 600/R-93-116

Location: 117-091, Suspect ACM Materials

Lab ID-Version‡: 3892296-1

Sample Layers	Asbestos Content
White Drywall	ND
Composite Non-Asbestos Fibrous Content:	2% Cellulose
Sample Composite Homogeneity:	Good

Location: 117-092, Suspect ACM Materials

Lab ID-Version‡: 3892297-1

Sample Layers	Asbestos Content
White Drywall	ND
Composite Non-Asbestos Fibrous Content:	2% Cellulose
Sample Composite Homogeneity:	Good

Location: 117-093, Suspect ACM Materials

Lab ID-Version‡: 3892298-1

Sample Layers	Asbestos Content
Black Mastic	2% Chrysotile
Blue Floor Tile	ND
Sample Composite Homogeneity:	Good

Location: 117-094, Suspect ACM Materials

Lab ID-Version‡: 3892299-1

Sample Layers	Asbestos Content
Black Mastic	2% Chrysotile
Blue Floor Tile	ND
Sample Composite Homogeneity:	Good

Location: 117-095, Suspect ACM Materials

Lab ID-Version‡: 3892300-1

Sample Layers	Asbestos Content
Black Mastic	2% Chrysotile
Blue Floor Tile	ND
Sample Composite Homogeneity:	Good

The results relate only to the items tested. Interpretation is left to the company and/or persons who conducted the field work. The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government.

All samples were received in acceptable condition unless otherwise noted. EMLab P&K reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: IHI Environmental, Phoenix
C/O: Mr. Rod Pawloski
Re: 11P-A3138; NAVAHCS-Bldg 117

Date of Receipt: 01-17-2012
Date of Report: 01-20-2012

ASBESTOS PLM REPORT: EPA-600/M4-82-020 & EPA METHOD 600/R-93-116

Location: 117-096, Suspect ACM Materials

Lab ID-Version‡: 3892301-1

Sample Layers	Asbestos Content
Gray Grout	ND
Sample Composite Homogeneity:	Good

Location: 117-097, Suspect ACM Materials

Lab ID-Version‡: 3892302-1

Sample Layers	Asbestos Content
Yellow Grout	ND
Sample Composite Homogeneity:	Good

Location: 117-098, Suspect ACM Materials

Lab ID-Version‡: 3892303-1

Sample Layers	Asbestos Content
Brown Fibrous Material	7% Chrysotile
Beige Stucco	ND
Composite Non-Asbestos Fibrous Content:	20% Cellulose
Sample Composite Homogeneity:	Good

Location: 117-099, Suspect ACM Materials

Lab ID-Version‡: 3892304-1

Sample Layers	Asbestos Content
Beige Fibrous Material	7% Chrysotile
Composite Non-Asbestos Fibrous Content:	80% Cellulose
Sample Composite Homogeneity:	Good

Location: 117-100, Suspect ACM Materials

Lab ID-Version‡: 3892305-1

Sample Layers	Asbestos Content
Beige Fibrous Material	7% Chrysotile
Composite Non-Asbestos Fibrous Content:	80% Cellulose
Sample Composite Homogeneity:	Good

The results relate only to the items tested. Interpretation is left to the company and/or persons who conducted the field work. The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government.

All samples were received in acceptable condition unless otherwise noted. EMLab P&K reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: IHI Environmental, Phoenix
C/O: Mr. Rod Pawloski
Re: 11P-A3138; NAVAHCS-Bldg 117

Date of Receipt: 01-17-2012
Date of Report: 01-20-2012

ASBESTOS PLM REPORT: EPA-600/M4-82-020 & EPA METHOD 600/R-93-116

Location: 117-101, Suspect ACM Materials

Lab ID-Version‡: 3892306-1

Sample Layers	Asbestos Content
Beige Fibrous Material	7% Chrysotile
Composite Non-Asbestos Fibrous Content:	80% Cellulose
Sample Composite Homogeneity:	Good

Location: 117-102, Suspect ACM Materials

Lab ID-Version‡: 3892307-1

Sample Layers	Asbestos Content
Beige Cementitious Material with Coating	ND
Sample Composite Homogeneity:	Good

Location: 117-103, Suspect ACM Materials

Lab ID-Version‡: 3892308-1

Sample Layers	Asbestos Content
Dark Brown Mastic	ND
Sample Composite Homogeneity:	Good

Location: 117-104, Suspect ACM Materials

Lab ID-Version‡: 3892309-1

Sample Layers	Asbestos Content
Red Grout	ND
Sample Composite Homogeneity:	Good

Location: 117-105, Suspect ACM Materials

Lab ID-Version‡: 3892310-1

Sample Layers	Asbestos Content
Red Grout	ND
Sample Composite Homogeneity:	Good

The results relate only to the items tested. Interpretation is left to the company and/or persons who conducted the field work. The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government.

All samples were received in acceptable condition unless otherwise noted. EMLab P&K reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".